WITTENBORG

TECHNICAL INFORMATION

TYPE NO	TYPE	T.I.-NO
FB 2800	**Freshbrew machines**	**. …02/02**

SERIAL NUMBERS AFFECTED	ISSUED BY
From machine number 524560	**Documentation/ Wittenborg Odense**

SUBJECT	ISSUED FOR (X):	
Change to brewer bracket	Action	
	Information	X

COMPONENTS CONCERNED

29578900 Bracket for brewer

MODIFICATION

- From the above machine number the quadrangular notch in the reinforcement piece between the side parts of the brewer bracket has been changed to 2 x 10 mm.

.

REASON

- The quadrangular notch has been enlarged to prevent the wires for the safety switch at the brewer from being squeezed by the rod for yoke. The previous notch tended to bee too small thus causing damage to the wire insulation during time.

CONTACT PERSON

- Technical
  Lars Rehr

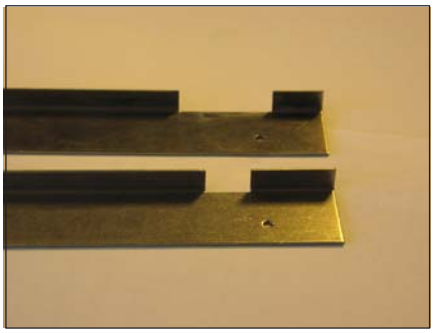

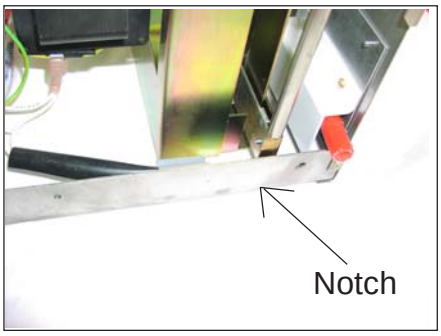

20.08.02	Grete Jensen	20.08.02	Lars Rehr
DATE :	PRODUCED BY :	DATE :	CHECKED BY :